

*NAB Maintenance



* Customers can put some grease on pivot points (red circle place), with brass or gunmetal bushings.



WD-40多种规格



* Let's maintain your machine!

NAB.5 HARDWARE
(shown in actual size)

A[1PCS]




B[1PCS]




C[1PCS]



D[1PCS]

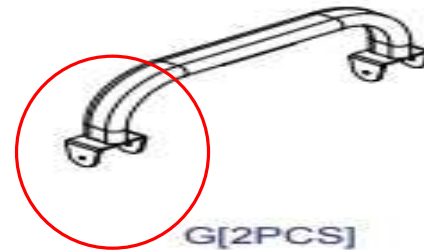

E[1PCS]

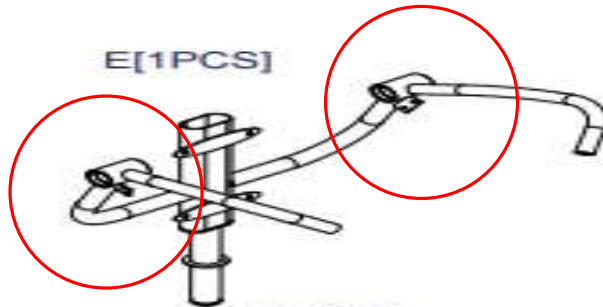

G[2PCS]



I[2PCS]
(8323-188)



K[1PCS]
(9121-101)



J[1PCS]
(9121-100)



NAB.5 HARDWARE (shown in actual size)

D1.M10 Bolt Cap.....	12PCS
D2.50X100 End Cap(9211-193).....	2PCS
D4.Rubber Pad(9310-076).....	4PCS
D5.38X4TX55L Rubber Slice(9310-028).....	1PCS
D6.Ø90x50x10t Rubber Circle(9310-016).....	1PCS
D7.Pinch Cock(OC06).....	1PCS

D1



D2



D4



D5




D6




D7



Above shows STEP
assembled and completed

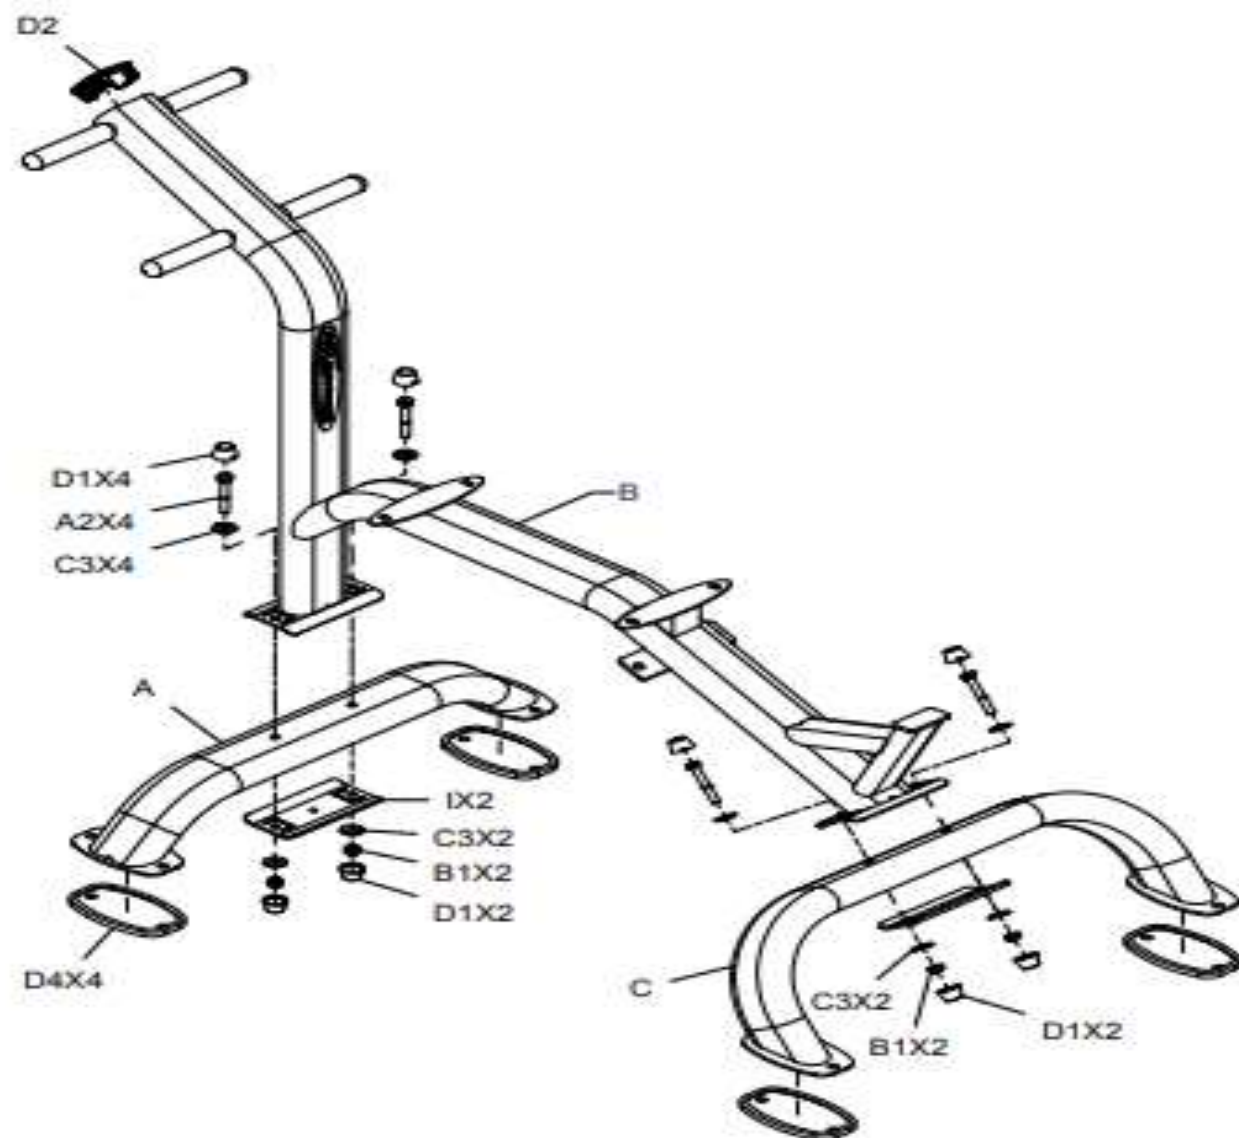

Above shows STEP
assembled and completed

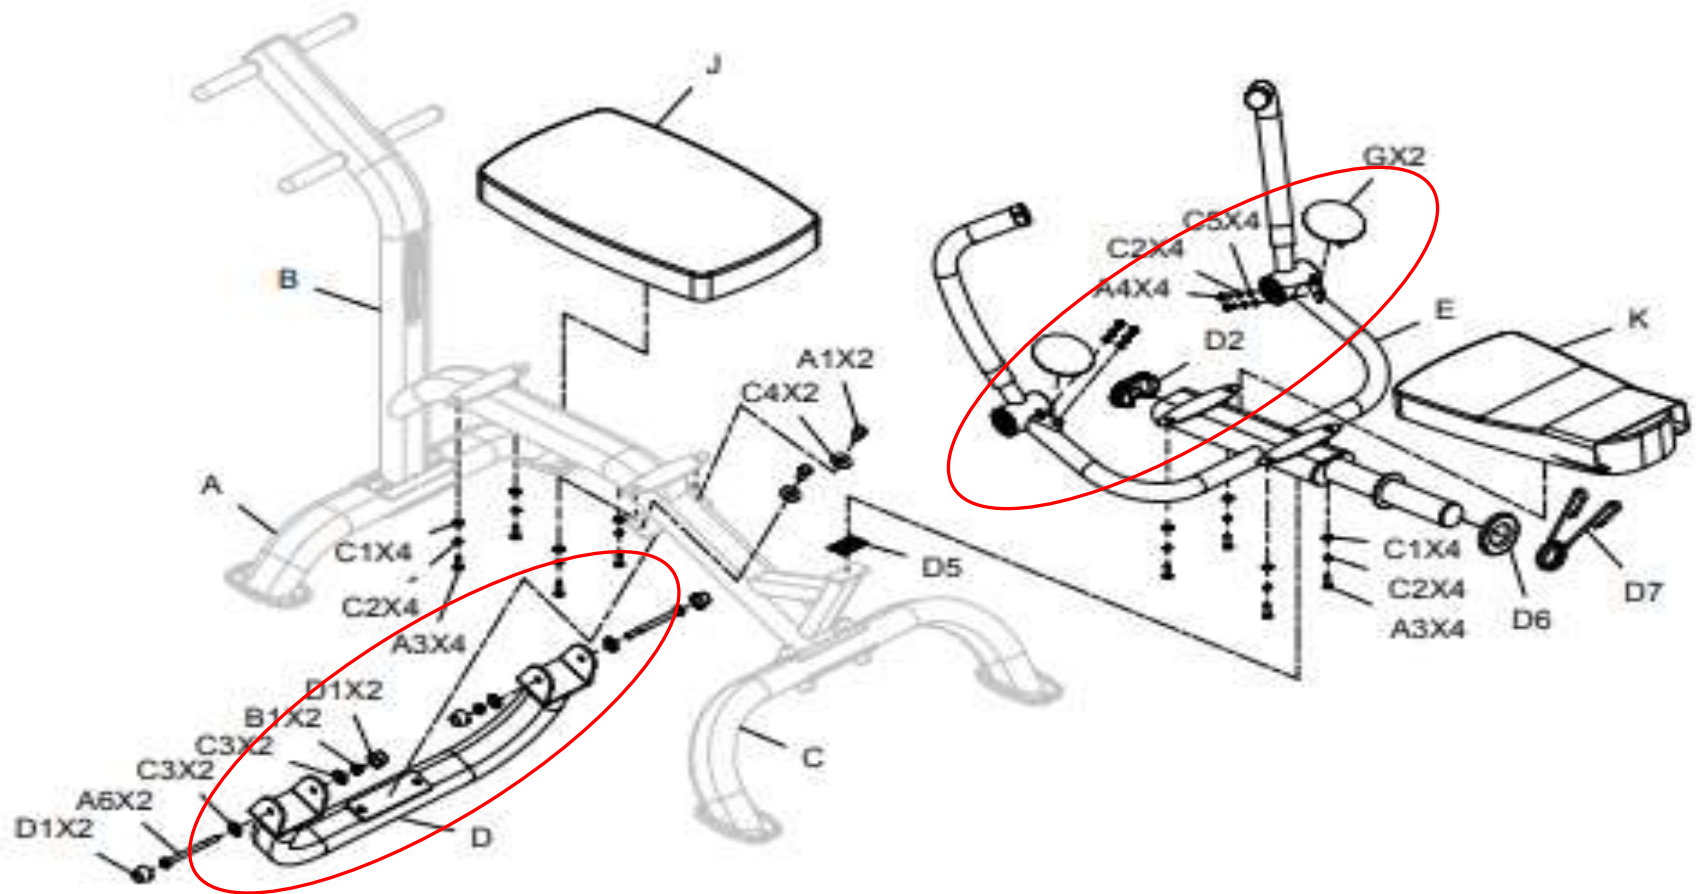

*Well done!

